

Tools and materials required:
 Stanley blade
 Scissors
 Crimp tool (see table below)
 Soldering iron
 Solder

Straight connectors for flexible cable

Cable entry: crimped

Connector types: (e.g.)

11 H4 - 50 - 3 - 3

11 H4 - 50 - 4 - 4

This connector
 is supplied
 in 3 parts

Suitable cables e.g.:

RG 58 C/U

RG 59 B/U

Centre contact:

soldered

soldered

Braid:





cavity B

cavity C


Crimp tool:

2 B (orange)


2 C (yellow)

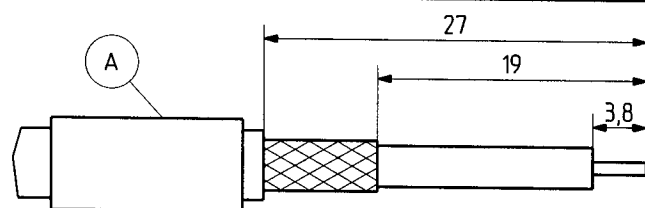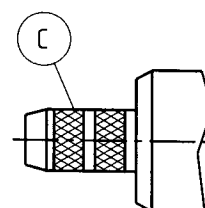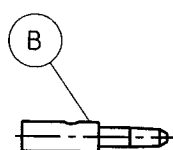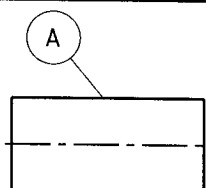


Slide ferrule A onto cable.
 Prepare cable according to diagram.
 CAUTION: Do not damage braid, dielectric
 and inner conductor of cable!

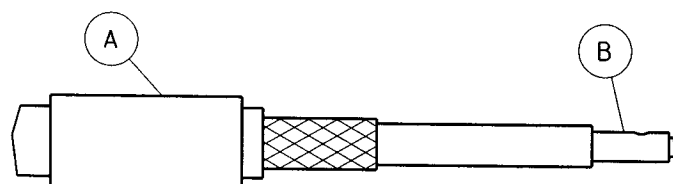

Push contact B over inner conductor of
 cable to about cable dielectric and solder.

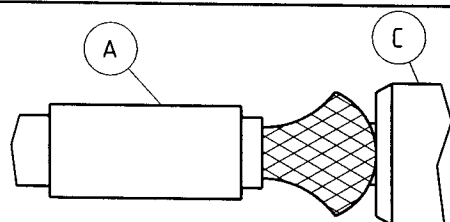

Splay out braid and insert cable in
 connector body C.
 Ensure that braid lies above the crimp neck.

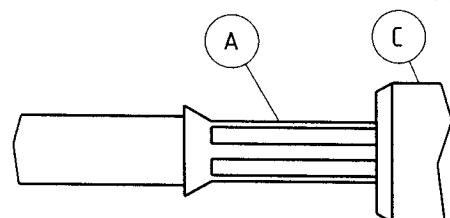

Slide ferrule A over braid and crimp
 as close to connector body C as possible.

SUHNER's skilled staff and specialised equipment are available to carry out complete R.F.lead-assembly on your behalf. We mount your connectors on cables at economic prices! Please contact our representative for further details of this service



HUBER + SUHNER AG CH-9100 HERISAU

Deutscher Text: siehe Rückseite

Benötigte Hilfsmittel:

Stanley-Messer

Schere

Klemmwerkzeug (siehe Tabelle)

Lötkolben

Lötzinn

Gerade Verbinder für flexible Kabel

Kabeleinführung: geklemmt

Verbinder-Typen: (z.B.)

11 H4 - 50 - 3 - 3

11 H4 - 50 - 4 - 4

Dieser Verbinder
wird in 3 losen
Teilen geliefert.

Geeignete Kabel: z.B.

RG 58 C/U

RG 59 B/U

Innenleiter:

gelötet

gelötet

Aussenleiter:





Aussparung B

Aussparung C

Klemmwerkzeug:

2 B (orange)


2 C (gelb)

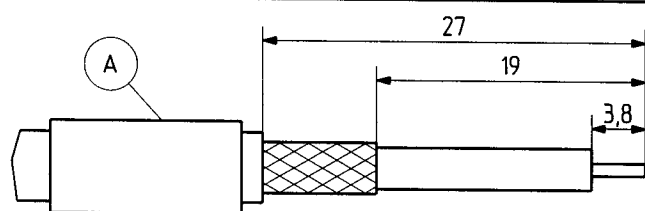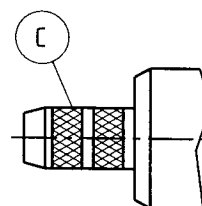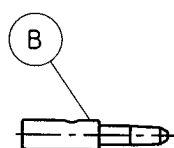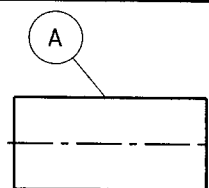


Hülse A auf das Kabel schieben.

Kabel gemäss Figur abisolieren.

ACHTUNG: Abschirmung, Dielektrikum
und Innenleiter nicht beschädigen!

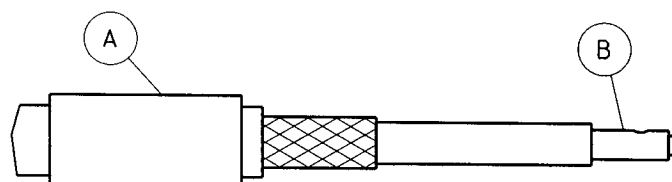


Kontakt B über Kabelinnenleiter bis zum
Dielektrikum stossen und löten.

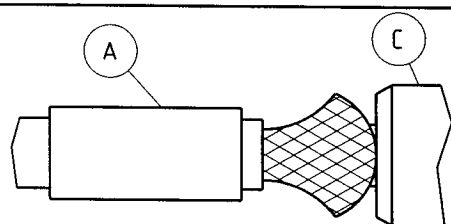

Abschirmung leicht aufspreizen und Kabel
in Gehäuse C einführen.

Abschirmung muss über Klemmhals liegen.

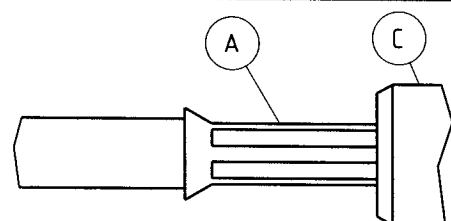

Hülse A über Abschirmung schieben.

und möglichst nahe am Gehäuse C klemmen.

SUHNER verfügt über gut ausgebildete Fachkräfte und rationelle Einrichtungen zur Herstellung kompletter HF-Verbindungsleitungen. Wir montieren Ihre Verbinder zu wirtschaftlichen Preisen! Wenden Sie sich an unsere Vertreter.



HUBER + SUHNER AG CH-9100 HERISAU

For English text see overleaf