

Tools and materials required :

Stanley blade

Scissors

Soldering iron

Solder

Soft hammer , small bench vice

Crimp tool : 1 A red

Angle connector for flexible cable

Cable entry : crimped

Connector types : (e.g.)

26-1023-C50-2-1c

26-1023-C50-2-2c

16-1023-C50-2-1c

16-1023-C50-2-2c

16-1023-C50-2-3c

16-1023-C50-2-4c

Suitable cables : (e.g.)

RG 174/U

RG 188 A/U




RG 316/U

G 02232

G 02232 D

K 02252 D

This connector
is supplied
in 3 parts

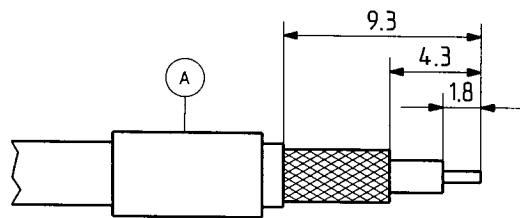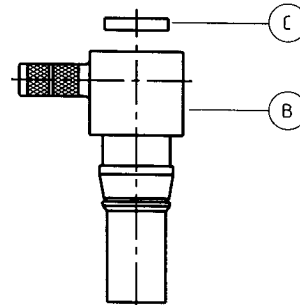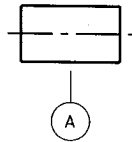


IMPORTANT: If use of taper sleeve or shrink-tube is intended, slide taper sleeve or tube on cable prior to stripping.

Slide ferrule A onto cable.

Prepare cable according to diagram.


CAUTION: Do not damage braid and inner conductor of cable.

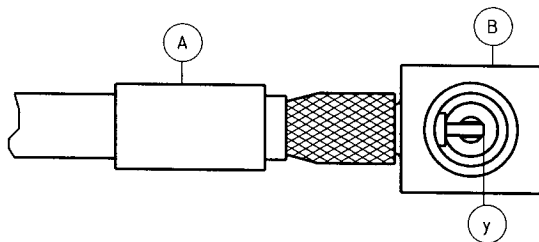

Splay out braid.


Slide prepared cable into connector body B until inner conductor of cable is flush at point y.

Ensure that braid lies above the crimp neck.

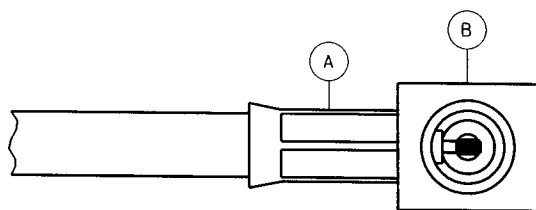

Slide ferrule A over braid and crimp as close to connector body B possible.

Solder inner conductor to contact.

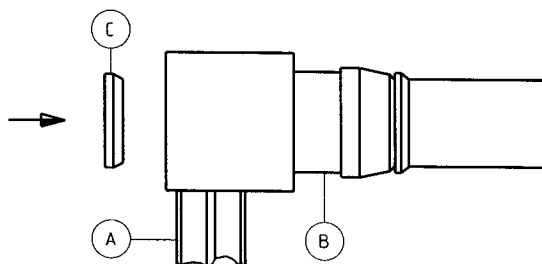

Place cover C on rear aperture of connector body B.

Carefully drive cover C into connector body B using a soft hammer, a small press, or a small bench vice.



HUBER + SUHNER AG CH-9100 HERISAU

Deutscher Text: siehe Rückseite

Benötigte Hilfsmittel :

Stanley Messer

Schere

Lötkolben

Lötzinn

Nylonhammer , Schraubstock

Klemmwerkzeug 1 A rot

Winkel-Verbinder für flexible Kabel

Kabeleinführung : geklemmt




Verbinder Typen: (z.B.)

26-1023-C50-2-1c
26-1023-C50-2-2c
16-1023-C50-2-1c
16-1023-C50-2-2c
16-1023-C50-2-3c
16-1023-C50-2-4c

Geeignete Kabel: (z.B.)

RG 174 /U
RG 188 A/U
RG 316/U
G 02232
G 02232 D
K 02252 D

Dieser Verbinder
wird in 3 losen Teilen
geliefert

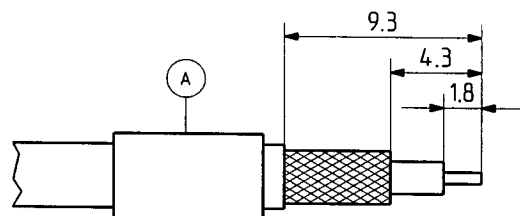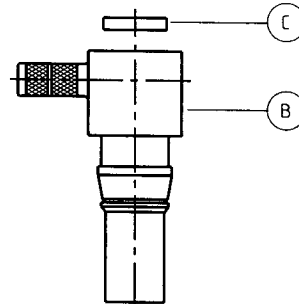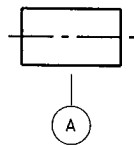


WICHTIG : Falls Knickschutzhülle oder Schrumpfschlauch verwendet wird, müssen diese zuerst auf das Kabel geschoben werden.

Hülse A auf das Kabel schieben.

Kabel gemäss Figur abisolieren.


ACHTUNG : Abschirmung, Dielektrikum und Innenleiter nicht beschädigen.

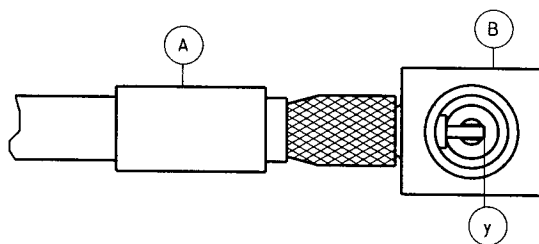

Abschirmung leicht aufspreizen.

Vorbereitetes Kabel in Gehäuse B stossen bis Innenleiter bei y bündig ist.


Abschirmung muss über Klemmhals liegen.

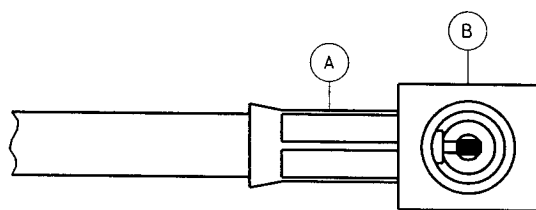

Hülse A über Abschirmung schieben.

und möglichst nahe am Gehäuse B klemmen.

Innenleiter mit Kontakt verlöten.

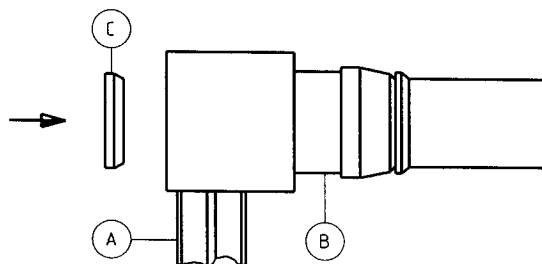

Deckel C auf Oeffnung in Gehäuse B legen.

Deckel C mit Presse, Nylonhammer oder Schraubstock einpressen.



HUBER + SUHNER AG CH-9100 HERISAU

for English text see overleaf