

Benötigte Hilfsmittel:

Stanley-Messer

Schere

Klemmwerkzeug (siehe Tabelle)

Gerade Verbinder für flexible Kabel
Kabeleinführung: SUHNER Voll-Klemmung
Verbinder Typen: (z. B.)

11UHF-0-3-17c 21UHF-0-3-1c	11UHF-0-4-14c 21UHF-0-4-1c	11UHF-0-7-21c 21UHF-0-7-6c	11UHF-0-7-17c 21UHF-0-7-2c
-------------------------------	-------------------------------	-------------------------------	-------------------------------

Dieser Verbinder
wird in 3 losen Teilen
geliefert

Geeignete Kabel:
Innenleiter:
Aussenleiter:
Klemmwerkzeug:

RG 58 C/U

RG 59 B/U

RG 11 A/U

RG 213/U

Aussparung 2

Aussparung 2

Aussparung 2

Aussparung 3

Aussparung B

Aussparung C

Aussparung D

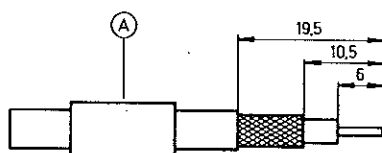
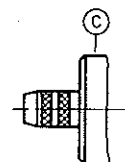
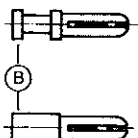
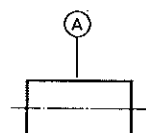
Aussparung D

2B (orange)

2C (gelb)

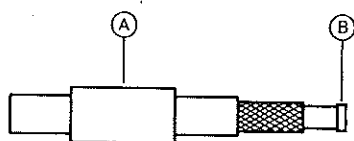
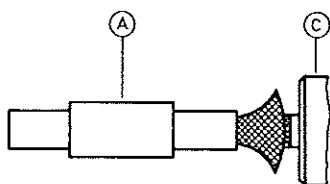
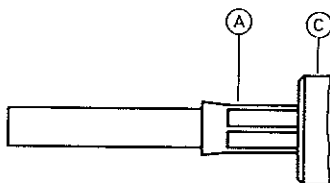
2D

3D (violett)



Hülse A auf das Kabel schieben.

Kabel gemäss Figur abisolieren.

ACHTUNG: Innenleiter, Abschirmung und Dielektrikum
nicht beschädigen!

Kontakt B über Kabelinnenleiter bis zum Dielektrikum
stossen und klemmen.

Abschirmung leicht aufspreizen und
Kabel in Gehäuse C einführen.
Abschirmung muss über Klemmhals liegen.

Hülse A über Abschirmung schieben
und möglichst nahe am Gehäuse C klemmen.

SUHNER verfügt über gut ausgebildete Fachkräfte und rationelle Einrichtungen zur Herstellung kompletter HF-Verbindungsleitungen. Wir montieren Ihre Verbinder zu wirtschaftlichen Preisen! Wenden Sie sich an unsere Vertreter.


HUBER+SUHNER AG
CH-9100 HERISAU

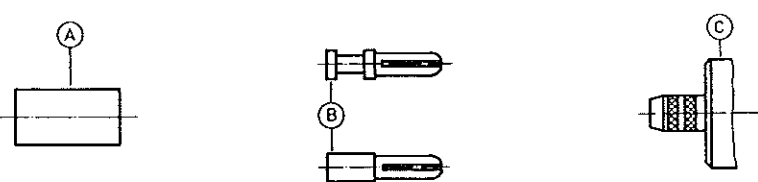
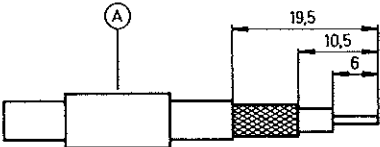
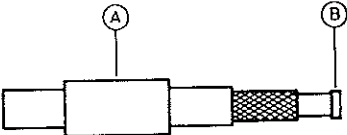
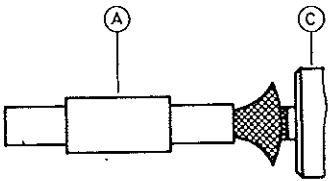
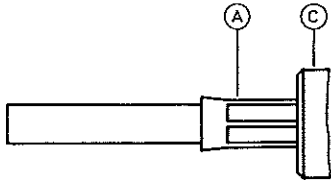
 
for English text see overleaf

Assembly instruction

Series UHF

E No. 3075

Tools and materials required: Stanley blade Scissors Crimp tool (see table below)		Straight connectors for flexible cable			
		Cable entry: SUHNER Full-Crimp			
		Connector types: (e. g.)			
This connector is supplied in 3 parts	Suitable cables e. g.:	11UHF-0-3-17c 21UHF-0-3-1c	11UHF-0-4-14c 21UHF-0-4-1c	11UHF-0-7-21c 21UHF-0-7-6c	11UHF-0-7-17c 21UHF-0-7-2c
	Centre contact:	RG 58 C/U	RG 59 B/U	RG 11 A/U	RG 213/U
	Braid:	cavity 2	cavity 2	cavity 2	cavity 3
	Crimp tool:	cavity B	cavity C	cavity D	cavity D
		2B (orange)	2C (yellow)	2D	3D (violett)

	
	Slide ferrule A onto cable. Prepare cable according to diagram. CAUTION: Do not damage braid and inner conductor of cable!
	Push contact B over inner conductor of cable to abut cable dielectric and crimp.
	Splay out braid and insert cable in connector body C. Ensure that braid lies above the crimp neck.
	Slide ferrule A over braid and crimp as close to connector body C as possible.
	

SUHNER's skilled staff and specialised equipment are available to carry out complete R. F. lead-assembly on your behalf. We mount your connectors on cables at economic prices! Please contact our representative for further details of this service.