

Assembly instruction Series N_B No. 27064

Tools and materials required:

Small saw : SUHNER 74 Z - 0 - 0 - 12

Knife or razor blade

Scissors, file

Crimp tool (see table)

Straight connector for flexible cables

Cable entry: SUHNER Full Crimp

Connector types: (e.g.)

11 N 50-7-37/16 N 50-7-28/24 N 50-7-24/25 N 50-7-24

This connector
is supplied
in 3 parts.

Suitable cable:

RG 393/U

Centre contact:





cavity 4

Braid:

cavity D

Crimp tool:


4 D

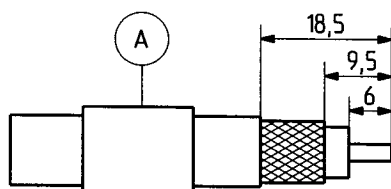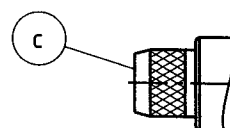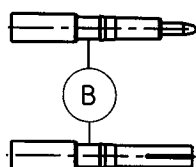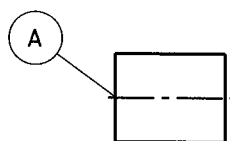


Slide ferrule A onto cable.

Prepare cable according to diagram.

CAUTION: Do not damage braid and inner conductor of cable!

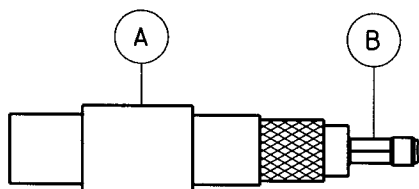


Push contact B over inner conductor of cable to abut cable dielectric and crimp.

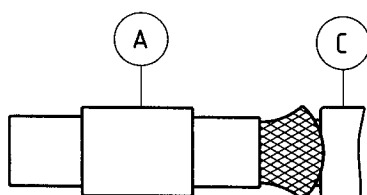

Splay out braid.

Insert centre contact B into connector body C as far as stop. Ensure that braid lies above the crimp neck.

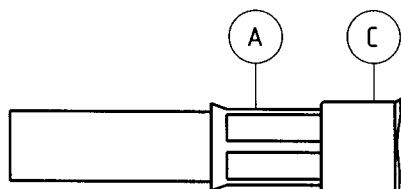

Slide ferrule A over braid

and crimp as close to connector body C as possible.

SUHNER's skilled staff and specialised equipment are available to carry out complete R.F. lead-assembly on your behalf. We mount your connectors on cables at economic prices! Please contact our representative for further details of this service.



HUBER + SUHNER AG CH-9100 HERISAU

Deutscher Text: siehe Rückseite

Benötigte Hilfsmittel:

Kleine Metallsäge : SUHNER 74 Z - 0 - 0 - 12
 Messer oder Rasierklinge
 Schere, kleine Feile
 Klemmwerkzeug (siehe Tabelle)

Gerader Verbinder für flexible Kabel

Kabeleinführung: SUHNER Voll-Klemmung

Verbinder Typen: (z.B)

11 N 50-7-37/16 N 50-7-28/24 N 50-7-24/25 N 50-7-24

Dieser Verbinder
 wird in 3 losen
 Teilen geliefert.

Geeignete Kabel:

RG 393/U

Innenleiter:





Aussparung 4

Aussenleiter:


Aussparung D

Klemmwerkzeug:


4 D

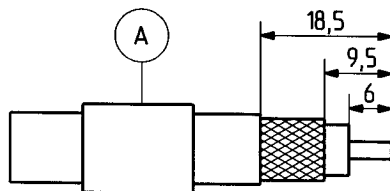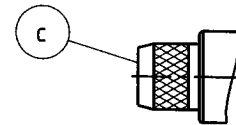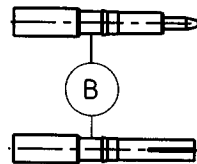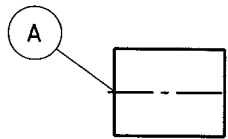


Hülse A auf das Kabel schieben.
 Kabel gemäss Figur abisolieren.
 ACHTUNG: Innenleiter, Abschirmung und
 Dielektrikum nicht beschädigen.

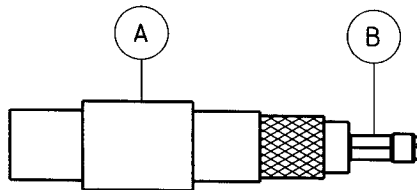

Innenleiter B über Kabelinnenleiter schieben
 und mit entsprechendem Werkzeug klemmen.

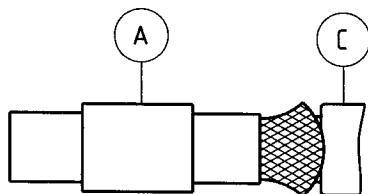

Abschirmung leicht aufspreizen.
 Vorbereitetes Kabel in Gehäuse C bis zum Anschlag
 einführen.
 Abschirmung muss über Klemmhals liegen.

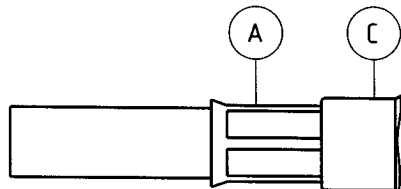

Hülse A über Abschirmung schieben und möglichst nahe
 am Gehäuse C klemmen.

SUHNER verfügt über gut ausgebildete Fachkräfte und rationelle Einrichtungen zur Herstellung kompletter HF-Verbindungs-
 leitungen. Wir montieren Ihre Verbinder zu wirtschaftlichen Preisen! Wenden Sie sich an unsere Vertreter.



HUBER + SUHNER AG CH-9100 HERISAU

for English text see overleaf